

COPYTHORNE PARISH COUNCIL MEETING – DECEMBER 13TH 2022

(Item deferred from October 11th 2022 meeting)

ITEM NO: 10 – Playground Inspection – Operational Maintenance Inspection Report / Summary of members Visual Inspections

Information

The latest Annual Inspection was carried out by N W Adams Engineering Design Services (Nick Adams), on August 31st 2022 and I received his report on September 10th 2022. A copy of the report is attached.

Also included in this report is a summary of the Parish Council Visual Inspection findings over the past few months, for information and in relation to the actions which have been or are planned to be undertaken.

Operational Inspection Findings

Numbered pages 1 to 7 of the report provide a summary of specific potential issues identified as being a risk (low/medium/high) with actions suggested by Nick Adams *in italics* and planned actions in response in **bold**:-

1. Access – *Across grass to basketball area may be a seasonal problem for those with mobility difficulty* **The returfed area remaining under a watching brief**
2. Access Pathway – *Matrix grass reinforcement settlement abutting the PCC edging creating a trip hazard. Adjust surface up flush to the edging to eliminate the trip zone* **Suggested action to be undertaken by a “working party”**
3. Litter Bin – *Loose on improved concrete flag base consider securing to fence to avoid tipping (low risk)* – **Monitoring in place no action considered required at this time**
4. Signs “Children’s play area No dogs allowed” attached to the MUGA. Radius accessible sharp corners of sign to 3mm minimum recommended. “Please shut gate” and “parents/guardians...” signs are not recommended as in windy conditions they can alter the designed /adjusted gate closing/opening times **Consider these recommendations as part of “working party” tasks.**
5. Basketball post & ring – Support post loose in ground – *Monitor closely for further loosening/programme to re-concrete.* **Monitoring in place via weekly visual inspections**
Bolts to rear of backboard Provide dome head/caps or cut off and file down to remove sharp edges (low risk) – **Bolts already cut off, edges to be checked by a “working party”**
6. Movement Clash - *Group seat swing installed too close to adjacent fence and mixed swing seat swing too close to the group seat – A minimum gap between each of 600mm is recommended (low/medium risk)* **Layout doesn’t allow for changes to be made (Nick is aware of this)**
7. MUGA – this item fails to meet the requirements of BSEN15312 in the following respect:- There are no anti-cycle bars (detachable) between the front side panels and the rear panel – **As Nick notes “An alternative gap has been provided adjacent to the ball screen to discourage persons from passing through the side of the panel**
8. MUGA – Erosion to the front & rear of the ball screen *Infill flush with compacted topsoil and re-grass all bare soil.* **This issue will be reviewed as part of the “working party”**
9. Footballs from field to playground – *Continue to monitor* – **Monitoring and recording of any instances is in place.** No received in last 12 months.
10. Flat Seat Swing/Cradle Seat – Missing recess caps (4) – *Replace. Untwist chains to extend their life.* **Both suggested actions to be undertaken by a “working party” (agreed with Nick that infill with bathroom silicone will be sufficient**

11. Group Seat swing – Seat height incorrect at 370mm (EN1176:2017). Reset to correct height, minimum ground clearance of 400mm measured beneath the lowest point. **This issue has not been raised in previous inspections and EN1176:2017 pre-dates the construction of the playground. Discussion to be had with supplier on how to resolve.**
12. Group Seat Swing – There is slight appreciable movement between the cross bar bracket & timber supports *Tighten all fixings(8)* – **Suggested action to be undertaken by the “working party”**
13. Group seat swing – There is surface corrosion visible to the upper exposed section of the chains. *Clean off* – **Suggested action to be undertaken by the “working party”**
14. Carousel – Note vibration when the carousel is rotated at higher speeds. *Monitor* **This is checked as part of weekly visual inspections**
15. Carousel – Note continued crumbing of the yellow EPDM safer surfacing wear pad (around carousel) – **To be discussed with Creative Play**
16. Trampoline – Minor Litter visible beneath the rebound surface - *Programme to remove, contact supplier regarding advice on access for cleansing.* **Supplier advised complete dismantling would be required (not under guarantee). “No risk issue”**
17. Trampoline – Loosened black rubber edging tile nearest to the adjacent multi-unit. *Resecure to the supporting metal frame beneath.* **Suggested action to be undertaken by the “working party” and if required referred to Creative Play.**
18. Multi-unit – *Loose vehicle drivers seat and steering wheel hub – Tighten loose fittings during a prolonged dry spell recommended.* **Suggested actions to be undertaken by a “Working Party”**
19. Multi-unit - *Various tightening of parts as detailed in report. Replace missing handgrip bolt caps –* **Suggested actions to be undertaken by a “Working Party”**
20. Multi-unit – There is concern by accidents on some types of overhead bars. *Medium/high risk* **This point has been raised by Nick on each inspection with an additional comment about the “strong development value in these items”. No action considered necessary.**
21. Multi-unit – *Recommend an additional feature panel board to the lowest part of the highest platform to provide additional rigidity/stabilise this part of the structure/refer to supplier* **The supplier has previous advised not considered necessary, will discuss with them again**
22. Multi-unit – Open Suspension bridge *Consider an additional platform beneath if a problem particularly for younger users/monitor.* **This has not been raised as an issue by users/parents, ongoing monitor.**
23. Challenge Trail – Loosened (but secure) cable link end eye bolts(4). *Tighten.* **Suggested action to be undertaken by a working party.**

Visual Inspections Summary

Below, in no particular order, is a table of the Visual Inspection findings, some of which are also covered in the listing above.

	Issue	Comments / Referral
1	Grass abutting the path near gate worn	See 2. above
2	Backboards panels to signs on fence delaminating (removed for repair)	Repairs still be undertaken with support of former Friends of Copythorne Playground group.
3	Squeak/rattle from carousel when rotated	See 14. above
3	Missing caps to swing seat screws	See 10. above
4	Rust on basket swing chains	Discussed with Nick, no concerns at present
5	Litter under trampoline	See 16. above
6	Some eye bolts on challenge trail appear loose	See 23. above
7	Multi use games area – ground surface wearing again	See 8. above Watching brief.
8	Basketball net post leans slightly	See 5. above

Recommendations

1. That the report and any action planning is noted
2. Continued use of Nick Adams to undertake annual inspection and operational inspection (6 months apart)
3. A Working party is established during late October/early November 2022 to undertake minor works repairs and changes, for which volunteers are sought.
4. An updating report will be provided once “working party” has undertaken suggested tasks

David Rigby

Clerk to Copythorne Parish Council

October 6th 2022

Annual Inspection Report of the Play & Sports facilities at
Pollards Moor Road, Copythorne

for

Copythorne Parish Council



Register of Play Inspectors
International Certificate No.1023A

N. W. Adams. IEng.,
19, Liddel Way,
Valley Park,
Chandler's Ford,
Hants. SO53 4QF

Tel. No. (023) 80255237
Mobile No. 07702 006686
Email: info@engineering-design-services.co.uk
Web: www.engineering-design-services.co.uk

31st August 2022

The following forms an integral part of the inspection report

1. *The equipment has been assessed, as relevant, in accordance with EN 1176: 2017 "Playground Equipment and Surfacing". The Multi Use Games Area (MUGA) has been assessed, as relevant, in accordance with BSEN 15312:2007 "Free access multi-sports equipment – Requirements, including safety and test methods."*

*Where there is a compliance failure, this is briefly noted and a risk assessment made of the failure. **Where it is believed action is required this is indicated in more detail (in italics) and identified as a medium or high risk** (see paragraph 13). Where no action is indicated, in my opinion there is no practical economic action that can be taken and the risks do not justify removal of the item.*

Low risk items should be monitored and if accidents occur, remedial action will be required (There is no such thing as NO risk). These failures to comply will continue to be monitored and, if necessary, will indicate action on future annual reports.

2. *The inspections cover:*

Site safety

Suitability and conditions of ancillary items

Standard compliance, suitability and condition of equipment

Dimensional compliance, suitability and condition of surfacing

Reports indicate the condition of the play area at the time of inspection. Subsequent events such as weather conditions, usage, or vandalism etc. may affect the condition of the play area (e.g. some surfaces may become slippery when damp). Regular inspections should be undertaken by the operator to monitor the effects of these.

3. *Standard assessment is undertaken where appraisal may be made without dismantling or destruction.*
4. *Inspections are non-dismantling inspections. Where it is felt that removal of parts for assessment is required, this will be indicated. (See paragraph 14). It is not possible to check for internal corrosion/rot without dismantling the equipment.*
5. *Surfacing has been assessed solely in terms of the area covered and its condition or security. Tests for impact absorbency are available at an economic rate if required.*
6. *Where there is open water within easy walking distance of the play area it is recommended that a water safety report be commissioned.*
7. *Where there are trees within falling distance of the play area it is recommended that a report on the integrity of the trees are obtained from a competent arboricultural expert (see www.trees.org.uk for list of qualified consultants)*
8. *Where no protective surface is provided with items which have a fall height in excess of 600mm, the installation of a protective surface should be considered. Such surfacing is not mandatory but does represent good practice. It should be noted that EN1176 & EN1177 allows well maintained grassed topsoil (not impeded by a high proportion of roots/solids/ stones/bricks) depending on conducive climatic conditions for fall heights up to 1.5m.*
9. *There should be an impact attenuating surface over the entire impact area beneath all equipment with a free fall height of more than 600mm and/or equipment causing a forced movement on the body of the user (i.e. swings, slides, rocking, cableways, carousels etc.).*
10. *In addition to inspecting the equipment and surfacing, the inspection also looked at ancillary items and general design features where relevant to safety.*
11. *Wear to shackle pins and bushes on swings is difficult to detect on non-dismantling inspections. Checks are made to identify excessive movement in the „D“ shackle and where dry bearings are obvious. Whilst this action can often identify serious defects it does not preclude the possibility of shackle pin failure in rare circumstances. It is recommended that random inspection by removal of the „D“ shackle and pin is carried out as a regular maintenance feature in the site owner's work programme.*

12. *It should be noted that this is a safety report, not a Standard compliance report, and compliance/non compliance with EN1176 is normally indicated. However where failures may not be mentioned where they are very minor, or of a technical nature, and have no noticeable effect on safety.*
13. *A risk assessment of faults and Standard failures is given in terms of low, medium and high. As a general principle items marked as "low" only require monitoring. Items marked as "medium" require appropriate action within resources and individual site assessment. Items marked as "high" require urgent action. In rare cases where an item is likely to result in major injury or death, the operator or appropriate representative will be notified from the site by telephone. This will be indicated on the report.*
14. *There can be problems with assessing ground decay where synthetic surface has been installed. Similar problems may occur with sub surface degradation. While every care is taken to check ground decay and corrosion in supports, this cannot be done fully without removal and destruction of the surface.*
15. *Many facilities are manufactured using timber or timber products. Small splinters are known in rare cases to develop to a projection upon contact and cause injury. Such splinters are very difficult to detect. Checks are made to identify such splinters where obvious but does not preclude the possibility of such circumstances occurring.*
16. *In order to provide economic reports, standard wording is used for most common standard/maintenance failures. The inspector also works using previous year's reports (where available). This may mean that where there have been few changes to the site, the current report may be similar to the previous year's report.*
17. *The Equality Act applies to play areas. There is a duty to, where practical, make reasonable provision for disabled people. EDS can advise.*
18. *The Management of Health and Safety Regulations require a risk assessment of the play area for risks to users. This is a highly specialised subject. Engineering Design Services can undertake such an assessment with the next annual inspection. EDS recommend that such formal risk assessments be undertaken every 4-5 years unless the play area is modified.*
19. *Items shown in Italics are recommended for action.*
20. *Items marked "monitor" should be included for the following inspections as defined in EN1176-1 and appropriate action should be taken when required;*
 - (a) *routine visual inspections*
 - (b) *operational inspections*
21. *Swing surfacing areas are calculated with the seat(s) set at the lowest height recommended by EN1176-2 (i.e. the maximum surfacing requirement).*
22. *Should you have any queries either telephone the number on the front cover, alternatively E-mail EDS on info@engineering-design-services.co.uk.*



RPiI Inspection Methodology

This document outlines the RPiI position on inspections undertaken by the Inspectors listed on the RPiI Register of Inspectors for Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it the date of the standard will be that current at the time of inspection with the exception of where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this would include public parks, play and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below);

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - „Guidance on Installation, Inspection, Maintenance and Operation“ (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 - Part7: 2020) contains no requirements and needs to be read and implemented as guidance, with the use of the term „shall“ therefore becoming a recommendation, as in the term „should“.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standard (BS EN 71 – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance within the inspection will still refer to BS EN 1176.

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPiI/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with current standards and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area up to 3.0 metres around, or the fence line if closer.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity wear and vandalism

Routine visual inspections (if undertaken) relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

The inspection is non-dismantling, non-destructive and does not include for any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all standing surfaces (where it is possible to stand without hand support) as necessary on the equipment and assess all parts up to 2.5m above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment. Ancillary equipment will be risk assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to risk assessment). The owner/operator is responsible for the overall safety of the equipment and area. Inspectors who are trained to use ladders may use them where it is safe to do so, but if members of the public are present on-site ladders may not be used to access the equipment.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of impact absorbing properties of any surfaces. The identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection or the inspection of any equipment (or part thereof) that is underground. Tightening any bolts, hinges or other fixing devices on any apparatus or equipment. Assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment. Assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming).

Where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken; the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a „design risk assessment“ provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a „suitable and sufficient assessment“ of the risks associated with a site or activity and this inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/ or that of the inspection company. The owner/operator should seek the advice of the manufacturer or a competent person at all times when undertaking repairs and/or modifications to equipment.

Table 1

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection Recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Maintenance of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Copythorne Parish Hall Play & Sports facilities

Date of inspection
31.8.2022.

General Comments

Limited potential casual supervision available from roads, footway & properties.

Early contact with the safer surfacing material supplier recommended regarding problems.

Ancillary Items

Access

Footpath to the play area.

Across grass to the basketball area may be a seasonal problem for those with a mobility difficulty.

Access pathway

Matrix grass reinforcement settlement abutting the PCC edging creating a trip hazard (this is partially due to wheel & push chair users having to step aside the gate arc to gain access).
Adjust surface up flush to the edging to eliminate the trip zone (photo 1). Medium risk



photo 1

Gate (1)

Controlled pedestrian gate (controller fitted) with a closure rate of 5 seconds.

Seats (2) ('William Lashmar' & 'The Wright Family')

Satisfactory.

Fencing

Theoretical entrapment between the abutting timber pales above the upper rail. Low risk

Litter bin (1)

Loose litter bin on an improved concrete flag base.

Consider securing to the rear fence to avoid tipping. Low risk

Signs (8)

„Children"s play area No dogs allowed" attached to the MUGA (1).

Radius accessible sharp corners of signs to 3mm minimum recommended.

Signs („Please shut gate" & „Parents/guardians") attached to gates are not recommended as in windy conditions they can alter the designed/adjusted gate closure/opening rates.

Basketball post & ring

Support post loose in ground.

Monitor closely for further loosening/programme to re-concrete.

Some erosion of playing surface (soil & grass). Make up playing surface level & flush with topsoil & re-grass in the appropriate season, if erosion & puddles remain a problem, programme for the provision of a durable artificial surface is recommended for consideration.

Warning notices displayed on the backboard "Do not hang from the ring" as required by BSEN15312 (2).

Minimum Space

See „Movement Clash" below.

Movement Clash

The „group" seat swing frame has been installed too close to the adjacent fence and the mixed seat swing too close to the „group" seat swing in both cases inviting passage through moving swing seats. *A minimum gap between each of 600mm is recommended.*

Low/medium risk

General surface/safer surfacing combined

See individual equipment notes.

Cleanliness and tidiness

Well maintained on a daily basis.

Equipment and Surfacing

1. Multi Use Games Area (MUGA)

BSEN15312 Compliance

The item fails to meet the requirements of BSEN 15312 in the following respect(s):

There are no anti-cycle bars (detachable) between the front side panels and the rear panel.

General Maintenance/safety comments

Basketball ring net in good condition.

Playing surface

Grass.

General Maintenance

Uneven natural grass/bare soil playing surface. *If erosion & puddles remain a problem, programming for the provision of a durable artificial surface recommended for consideration.*

Erosion/holes to the front & rear of the ball screen. *Infill flush with compacted topsoil and re-grass all bare soil.*

An alternative gap has been provided adjacent to the ball screen to discourage persons from passing through the side of the panel.

Continue to monitor for sports balls recommended conflicting with persons using the through route and play area.

2. 2.38m maximum, 1 bay, 1 cradle/1 flat seat swing (Creative Play)

EN 1176 Compliance

The item meets the requirements of EN1176 where this may be tested on site without dismantling or destruction.

General Maintenance/safety comments

Mixing cradle/flat swing seat types in one bay is not recommended. If two or more bays or independent swing frames are available separate the seat types. In cases where only one bay or swing frame is provided no recommendation for action is made (see „Movement Clash“).

Missing recess caps (4) to the upper cradle crotch strap fixings. *Replace.*

Untwist chains to extend their life.

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176.

General Maintenance

The surfacing is in satisfactory condition and no work is required at this time.

3. 2.36m maximum, 1 bay, 1 'group' seat swing (Creative Play)

EN 1176 Compliance

The item meets the requirements of EN1176 where this may be tested on site without dismantling or destruction.

General Maintenance/safety comments

Entrapments within the cabled webbing of the „nest“ seat. Low risk

Seat height incorrect at 370mm (EN1176:2017).

Re-set to correct height. To meet EN1176, the minimum ground clearance is 400mm for „group“ type seats measured beneath the „lowest“ point (including when the seat leading edges are beneath the cross bar). A maximum seat surface to ground distance of 634mm is recommended. Low/medium risk

There is slight appreciable movement between the cross bar bracket & timber supports.
Tighten all fixings (8).

There is surface corrosion visible to the upper exposed section of the chains. *Clean off.*

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176.

General Maintenance

The surfacing is in satisfactory condition and no work is required at this time.

4. Spinner (without seating) (Creative Play)

EN 1176 Compliance

The carousel meets the requirements of EN1176 when unloaded, where this may be tested on site without dismantling or destruction.

General Maintenance/safety comments

Note vibration when the carousel is rotated at higher speeds. *Monitor.*

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176.

General Maintenance

Note continued „crumbing“ of the yellow EPDM safer surfacing wear pad. *Refer to Supplier.*

5. Bouncing Facility (1.44m x 1.44m) (EuroTramp)

EN 1176 Compliance

The item meets the requirements of EN1176 where this may be tested on site without dismantling or destruction.

General Maintenance/safety comments

Minor amount of litter beneath the rebound surface. *Programme to remove/contact the supplier regarding advice on access for cleaning.*

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176 (1.72m to fence).

General Maintenance

Loosened black rubber edging tile nearest to the adjacent multi-unit.
Resecure to the supporting metal frame beneath.

6. Multi-unit (Creative Play)

EN 1176 Compliance

The item meets the requirements of EN1176 where this may be tested on site without dismantling or destruction.

(Note where the slide access (platform) is greater than 1.2m from the ground, the slide wall height perpendicular to the sliding surface should be 150mm minimum). Low risk

General Maintenance/safety comments

Loose vehicle „drivers“ seat. *Tighten loose fixings during a prolonged dry spell recommended.*

Loose „steering wheel“. *Tighten centre hub fixing.*

Replace the missing gear lever.

Slackened suspension bridge chains allowing the boards to contact. Low risk

Tighten loosened bar access fixings to the slide facing the „Wright“ seat to prevent rotation.

Tighten loosened bolts (4) at both ends of overhead sloped ladder & rung bracket fixings during a prolonged dry spell recommended.

Tighten vertical net climber cable end fixings (12) during a prolonged dry spell recommended.

Tighten plastic panel fixings into timber during a prolonged dry spell recommended.

Replace missing handgrip bolt caps (4) above the vertical net.

Loose upper most step riser board. *Tighten fixings (3).*

There is concern by accidents on some types of overhead bars. There is, however, a strong development value in these items. *If possible, on angled or „S“ shaped bars, consideration should be given to level bars with firm grips & even spacings. The protective surface under all bars must be kept in good condition.* Medium/high risk

Recommend an additional feature panel board to the lower part of the highest platform to provide additional rigidity/stability to the structure/refer to the Supplier.

Open suspended bridge. *Consider an additional platform beneath if a problem particularly for younger users/monitor.*

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176 (1.72m to fence).

General Maintenance

The surfacing is in satisfactory condition and no work is required at this time.

7. Challenge trail (Creative Play)

EN 1176 Compliance

The item meets the requirements of EN1176 where this may be tested on site without dismantling or destruction.

General Maintenance/safety comments

Loosened (but secure) cable link end eye bolts (4). *Tighten.*

Surfacing

Wet pour

Surfacing area dimensions

The surfacing meets the requirements of EN1176 (1.72m to fence).

General Maintenance

The surfacing is in satisfactory condition and no work is required at this time.